

MONUMENT RECORD

Corner I.D. #

P-13


STATE OF INDIANA - COUNTY OF MONROE

Section Fifteen (15), Township 10 North, Range 1 West

Monument Description & Remarks: Found Stone at SE Corner of W 1/2 of SE 1/4.

Stone was 4.5" X 6.5" X 7" out of ground, marked with "X". Corner
witnessed 10/18/85. Steel fence post adjacent.

Recovery Tie Drawing

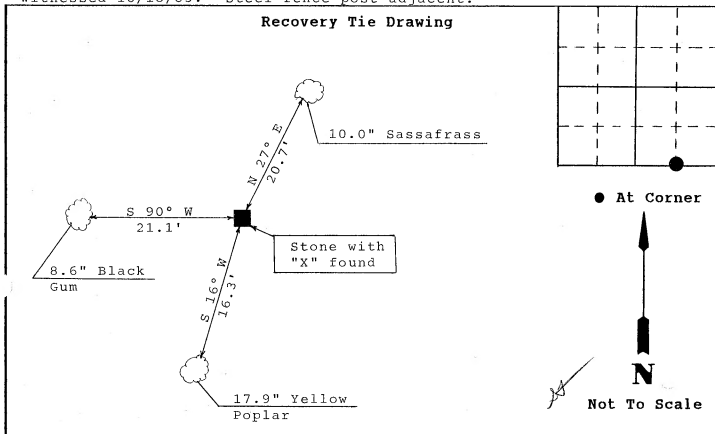

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 8th day of November, 19 93 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest
 United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a

October 18, 1985

-compass reference line flagged June 28, 1984, was used to verify sketchy wire evidence found on east side of section. Hole claimed by Gorman as section corner was accepted based on best fit: a compass azimuth 179° 34' (1° W declination) ran from pin found north of Chamber's Pike at NE section corner would pass close to all evidence found on section line. The hole was witnessed as follows:

| | | | |
|----------------------|------|-------------|------|
| SE corner of SEC 15 | | | |
| Azimuth (°) | 078 | 132 | 015 |
| Reference (SPP) BLO* | | pipe-NW BLO | |
| | | corner | |
| | | Tract 6** | |
| DBH | | | |
| ob (in) | 14.4 | | 22.0 |
| Distance (ft) | 29.4 | 42.6 | 22.3 |

*See sec 22, and
#1A
sec 15, #1A+1C
also
see #4, sec 15*

*has witness nails in blazes 2 ft. from ground for lath labeled SEC 23 corner

**subdivision in SEC 23: located 34 ft. south of lath labeled SEC 23 corner (sits right next to BLO* on NW side of tree) Lee Hutt--surveyor

There appears to be a 29 ft. E-W offset between the SE corner SEC 15 and the NE corner SEC 22 (NW corner SEC 23) This offset was verified by evidence found along NE $\frac{1}{2}$, NE $\frac{1}{4}$, SEC 22 E boundary. The E side of E $\frac{1}{2}$, SE $\frac{1}{4}$, SEC 15 was painted with orange paint and posted with plastic signs.

-two stones were witnessed as follows:

*SW corner E $\frac{1}{2}$ SEC 15--dome shaped-4" high with mark "X"

| | | | |
|---------------|------|------|------|
| Azimuth (°) | 236 | 147 | 077 |
| Species | SUM | SUM | PIH |
| DBH | | | |
| ob (in) | 06.6 | 15.8 | 10.2 |
| Distance (ft) | 10.6 | 34.1 | 15.5 |

* SE corner W $\frac{1}{2}$, SE $\frac{1}{4}$ SEC 15 4 $\frac{1}{2}$ "x6 $\frac{1}{2}$ "x7" (LxWxH) with "X"

| | | | |
|---------------|------|----------------------|------|
| Azimuth (°) | 027 | 270 ^{±90°W} | 196 |
| Species | SAS | BLG | YEP |
| DBH | | | |
| ob (in) | 10.0 | 08.6 | 17.9 |
| Distance (ft) | 20.7 | 21.1 | 16.3 |

*See #4-
Note*

next to SUM stub--upper stem was laying on stone which was broken and slightly shifted north by fall--stone was straightened after clearing away debris

-the west and south boundaries of SW $\frac{1}{2}$, SE $\frac{1}{4}$ were painted and posted with plastics signs.

-the SW corner E $\frac{1}{2}$, NE $\frac{1}{4}$ was established as follows:

=a compass line was run north from SE corner W $\frac{1}{2}$, SE $\frac{1}{4}$ to the north section line where a fence corner next to a gate behind Gary Fishel's house was found to be due south of a pin line along Chamber's in SEC 10.

E. =a compass line was run east from NW corner, NE $\frac{1}{4}$, SW $\frac{1}{4}$ to a 29.3" beech with wire that appeared to be on the section line in June, 1984. Wire closing on this tree from the east and west suggests that it is the $\frac{1}{4}$ - $\frac{1}{4}$ corner.

F. =SW corner E $\frac{1}{2}$, NE $\frac{1}{4}$ was calculated and located from the intersection at above mentioned compass lines. It is due east of NW corner, NE $\frac{1}{4}$, SW $\frac{1}{4}$ (1° W declination) and Az 360° 10' from SE corner W $\frac{1}{2}$, SE $\frac{1}{4}$. This corner was posted with plastic signs and can be relocated by the following witnesses:

| | | | |
|---------------|---|------|------|
| Azimuth | 079 | 027 | 128 |
| Species | | REM* | REM* |
| Reference | Old metal boundary Signs @ errant fence corner | | |
| DBH | | | |
| Ob (in) | On Fishel's Property | 3.3 | 4.5 |
| Distance (ft) | 139.3 | 5.7 | 8.9 |

*posted with plastic boundary signs

=contradictory evidence was observed at the middle of NE $\frac{1}{4}$. A white oak with wire was observed 40.5 ft west of the calculated boundary line near the $\frac{1}{4}$ - $\frac{1}{4}$ corner. However, it was rejected as being too far out of agreement with other evidence. It sits on the state side of the fence about 45 ft.

=the south and west sides of SE $\frac{1}{4}$, NE $\frac{1}{4}$ were painted and posted. the west side of NE $\frac{1}{4}$, NE $\frac{1}{4}$ was not painted, but there is a well-maintained and obvious fence-line.

Darrell Breedlove

Darrell Breedlove, Timber Specialist

Sec # 30
4. On July 29, 1988, a steel fence post was driven next to the stone at the southwest corner, SE $\frac{1}{4}$, SE $\frac{1}{4}$, Sec.15. This stone, also, has a pipe next to it that was driven as part of an adjoining survey (surveyor: Guy Moore). It was set by witnesses (see entry#3*) following disturbance by loggers in 1986. The stone was recovered by Breedlove and positioned next to the pipe.

Sec # 3A
Also on this date, a steel fence post was driven at the SE corner, of Sec.15. According to Hugh Gorman(see entry#1), Farkas, Monroe County Surveyor, substantiated that the stone had been destroyed and that the depression was the correct location of the section corner. The post was driven next to another thin, steel, channel marker found in the depression.

Darrell Breedlove

Darrell Breedlove, Timber Specialist